



Trunk & Distribution Adapters

90° Socket Contact Installation Guide



Applicable Part Numbers

GL-90-SC-T	GL-90-SC-w/4.5-T
GL-90-SC-w/1.5-T	GL-90-SC-w/6-T
GL-90-SC-w/3-T	GL-90-SC-w/9-T

Recommended Tools

- 1 — 10" Adjustable Wrenches
- 1 — 3/4" Combination Wrench

1. Remove equipment port caps and loosen seizure screws to accept adapter pin. Verify length and trim the adapter pin to equipment manufacturer's specification.
2. Using the trim gauge provided on the adapter, trim the pin of the entry connector to the required length.
3. Screw the lock nut back against the adapter body.
4. Screw the adapter into the equipment housing until finger tight. The o-ring should be inside the equipment port.
5. Position the adapter by backing the adapter out of the equipment port until desired alignment is achieved.
(NOTE: adapter should not be backed off more than one turn.)¹
6. Thread the entry connector body into the adapter's entry port and tighten using two (2) wrenches. Complete entry connector installation onto cable per manufacturer's instructions.
7. Hold the adapter body rigidly and wrench tighten the lock nut securely against the female port.
8. Tighten seizure screws inside of the equipment as recommended by the equipment manufacturer. Replace port caps.

¹ Extension Adapters:

Tighten the extension into the equipment port. To adjust the adapter angle, hold the adapter body and loosen the lock nut. Position adapter body to the desired position. Tighten lock nut.

Trim Locations

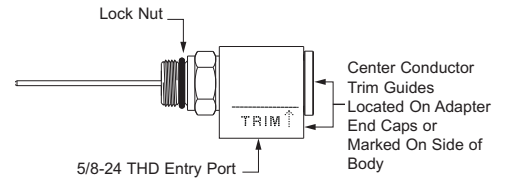


Figure A

End Marked Trim Guide

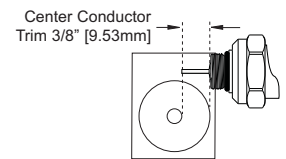


Figure B

Side Marked Trim Guide


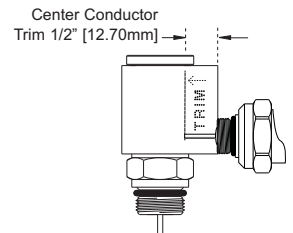


Figure C

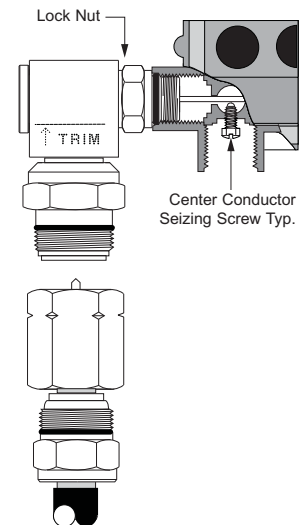

Corning Gilbert Inc.
Broadband Products

5310 W. Camelback Rd. Glendale, AZ 85301 U.S.A.

phone: 800 528 5567 fax: 800 344 6358 (U.S. & Canada)

(01) 623 245 1050 (01) 623 939 3538 (International)

e-mail: info-gilbert@corning.com website: www.corning.com/corninggilbert