



UltraRange™ Connector Installation

Cable Preparation

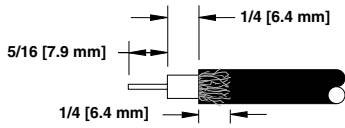

Prepare cable with an appropriate tool to dimensions shown. Fold exposed braid back over jacket. Leave foil attached to dielectric. (Don't Score Center Conductor).


For Quad Shield Cables: Fold outer braid back over jacket, remove outer foil, fold inner braid back over jacket.

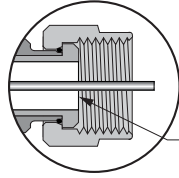

Dielectric is flush with the end of connector post

Push connector onto cable until dielectric is flush with the support post face.

UltraEase™ Connector Installation

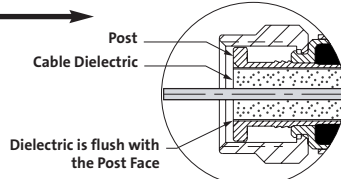

Dielectric is flush with the Post Face

Push connector onto cable until dielectric is flush with the support post face.


Connector Activation

UltraEase™



Insert connector/cable into the compression tool. Compress the connector until positive stop is reached.

UltraRange™

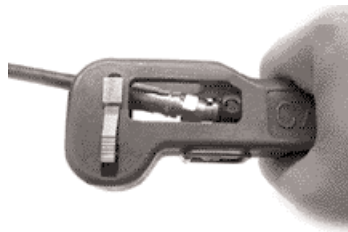

Insert connector/cable into the compression tool. Compress the connector until positive stop is reached.

360




Place connector into the jaws of the .360 hex crimp tool. Make sure the hex of the crimp ring is aligned with the hex of the jaws of the crimp tool. Align the end of the connector crimp ring flush with the edge of the crimp tool jaws. Crimp the connector until a positive stop is reached.

USA



Place connector into the jaws of the .360 hex crimp tool. Align the end of the connector crimp ring flush with the edge of the crimp tool jaws. Crimp the connector until a positive stop is reached.

Outdoor Applications

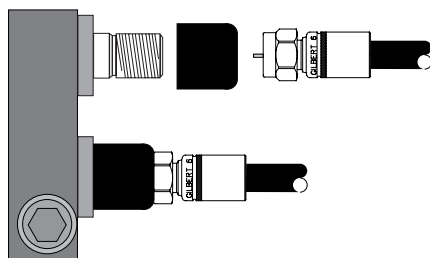

- Push seal ring (G-SR-1/2) onto outdoor port
- Install connector finger tight
- Using a 7/16" wrench, tighten to system specifications